

## A seismically triggered landslide dam in Honshiyuan, Yunnan, China: from emergency management to hydropower potential

**Abstract** At 16:30 (Beijing time) on August 3rd, 2014, an Ms 6.5 earthquake occurred in Ludian County in Yunnan Province, China. The Ludian earthquake triggered a collapse in Chapingzi, right bank of the Niulanjiang River, and a landslide in Hongshiyuan at the left bank on the same location. These events occurred 1.5 km downstream of the Hongshiyuan hydropower station. Debris deposits from the collapse and the landslide blocked the river channel and formed a landslide dam. In this study, the Hongshiyuan landslide dam induced by the Ludian earthquake was chosen as the study case to discuss integrated landslide dam management and its potential hydropower uses. After emergency management measures are carried out, further analysis shows the outflow through the Hongshiyuan landslide dam is manageable, which indicate safety issues are controllable. Two management schemes are discussed in this paper: one that uses the Hongshiyuan landslide dam for power generation and one that removes the debris deposit. The result shows that using the strengthened landslide dam for power generation is feasible and economically sound. This research estimate a capital recovery period of approximately 3 to 4 years with an investment-return ration of 1:40, which is considered a significant economic benefit.

**Keywords** Ludian earthquake · Landslide · Landslide dam · Stable assessment · Hydroelectric power

### Introduction

On August 3rd, 2014, an Ms 6.5 earthquake occurred in Ludian County of Yunnan Province, China. The epicenter with a focal depth of 12 km was located near Longtoushan town in Ludian County (27° 6' 0" N, 103° 17' 60" E). By August 8th, 2014, this earthquake resulted in 617 deaths, more than 3000 injured persons, and a significant number of houses destroyed. The Ludian earthquake triggered the Chapingzi collapse and Hongshiyuan landslide from the right and left bank of the Niulanjiang River, respectively. Both events occurred downstream the Hongshiyuan hydropower station. The ensuing accumulation body blocked the river channel and formed the Hongshiyuan landslide dam. Landslide dams are expected to be generally loose and thus extremely prone to fail causing catastrophic downstream flood or debris flow soon after its formation.

Costa and Schuster (1988) analyzed 73 landslide dams and concluded that the longevity of more than 50 % of natural dams were less than 10 days. Casagli and Ermini (2002) analyzed 205 landslide dams and found that more than 55 % of them breached within 10 days after their formation. A landslide dam breach usually results in catastrophic downstream flash floods or debris flow causing loss of life, property, and infrastructure. For example, in 1786, an Ms 7.5 earthquake occurred in the Kangding-Luding

area of Sichuan Province, inducing the formation of a large landslide dam in the Dadu River. This dam suddenly breached 10 days later and caused downstream floods resulting in more than 100,000 deaths (Dai et al. 2005). On April 9th, 2000, a large landslide occurred in Bomi County, Tibet, China. The accumulation body from this large landslide with a volume of  $3 \times 10^8 \text{ m}^3$  blocked the Yigongzangbu River creating a landslide dam. On June 10th, 2000, this landslide had a partial breach leaving 30 dead and 100 missing (Shang et al. 2003).

Landslide dam failure is a complex geohazard that has received increasing attention in many countries (Korup 2002; Xu et al. 2009). Research on this subject has focused on rapid safety assessment of landslide dams (Costa and Schuster 1991; Canuti et al. 1998; Casagli and Ermini 1999, 2002; Ermini et al. 2006; Dong et al. 2009, 2011, 2014; Petley 2010; Peng and Zhang 2013). Analyses of geomorphometric parameters suggest that landslide dam height, volume, and upstream catchment area are key factors for safety assessment (Korup 2004). Casagli and Ermini (1999, 2002) used dam height, volume, and upstream catchment area as indices to assess the stability of landslide dams. Based on works of Casagli and Ermini (1999, 2002), Chen et al. (2014) and Dal Sasso et al. (2014) successfully assessed the stability of landslide dams in the Taiwan area and Noce River. Dong et al. (2009) utilized the peak flow (or upstream watershed area), dam height, width, and length as variables in the construction of a multivariate regression model that had an 88.4 % prediction rate (Dong et al. 2009).

With the progress of research on landslide dams, it was found that grain-size distribution of the dam material is a decisive factor influencing the overall strength of landslide dams. This factor is related to erosion processes that can lead to failures by overtopping or piping (Swanson et al. 1986; Costa and Schuster 1988; Casagli and Ermini 1999; Casagli et al. 2003). Several scholars have analyzed the effects of grain size distribution on the stability of landslide dams (King et al. 1989; Plaza et al. 1990; Mora et al. 1993; Xu et al. 2009). The results of these studies suggest that landslide dams mainly composed of coarse particles are more stable (Casagli et al. 2003; Wang et al. 2010). However, Wang et al. (2010) pointed out that if the dams are composed of both coarse and fine particles, then the self-stabilization process would require a long time period, and the risk of breaching would be high during this time. Cui et al. (2009) classified landslide dams into four risk levels (extremely high risk, high risk, medium risk, and low risk) by translating the material composition into assessment indices, and qualitatively analyzed the stability of 32 landslide dams with detailed data from the Wenchuan earthquake region.

Landslide dams with poor stability pose high breaching risks. Emergency management measures should be executed based on rapid stability assessment (Wang et al. 2010) as soon as possible. Thus, the management of landslide dams can be generally divided

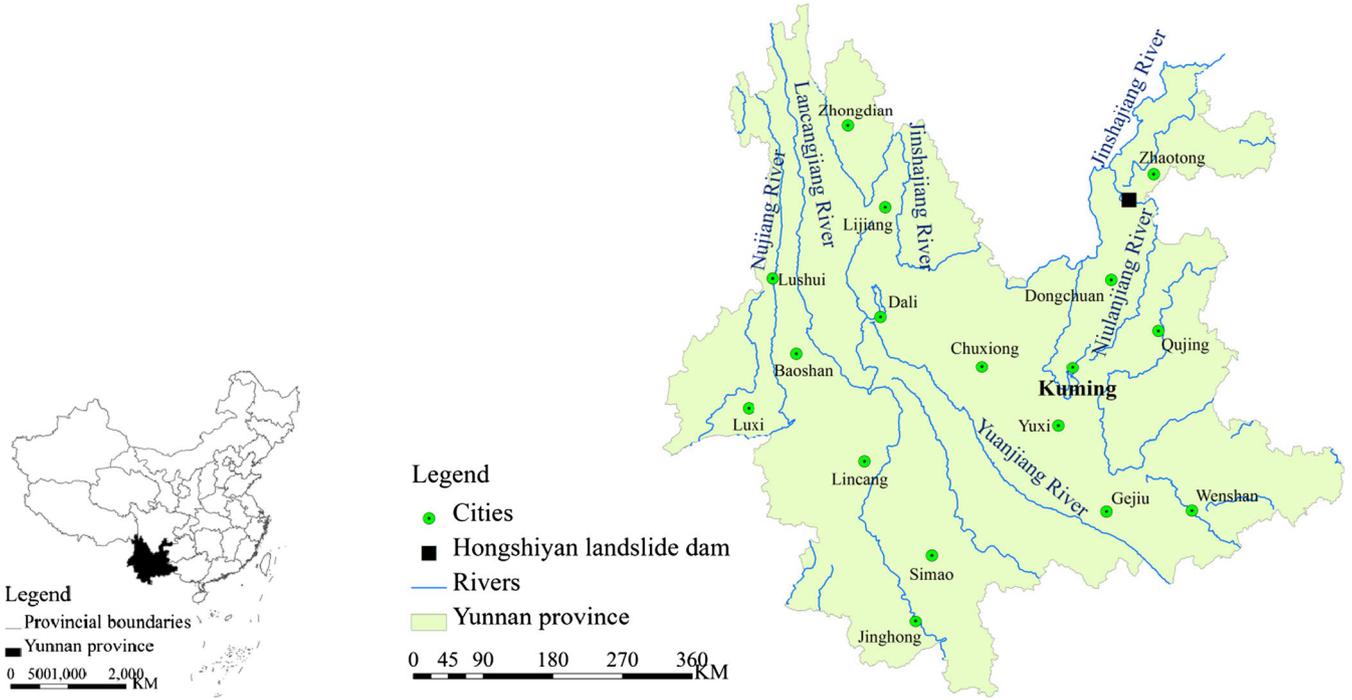


Fig. 1 Location of the Niulanjiang River and the Hongshiyuan landslide dam in Yunnan Province

into two periods: emergency management that prevents the potential hazard situations immediately after the formation of the landslide dam and integrated management after emergency measures are in place.

The first period focus on how to prevent, or at least decrease, the breaching probability of a high-risk landslide dam and on making the dam manageable. Engineering measures such as excavating spillways or emergent spillway tunnels are mandatory in


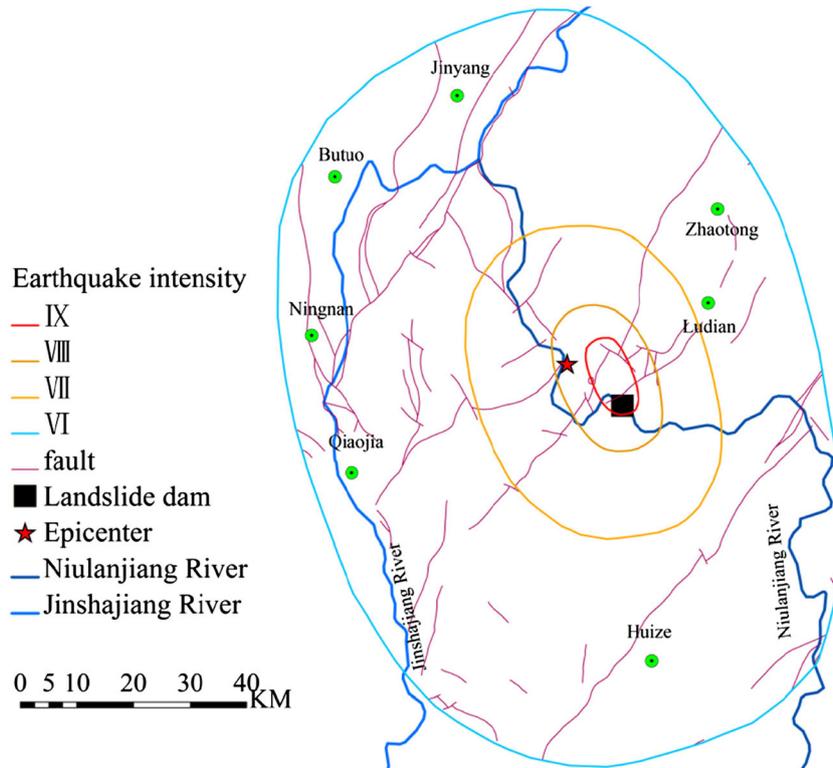


Fig. 2 Location of the epicenter and distribution of faults in Ludian earthquake region

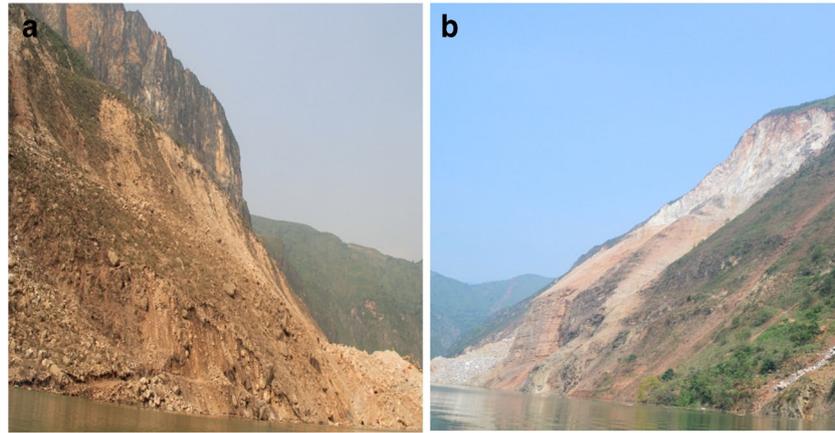

**Fig. 3** Two landslides induced by the Ludian earthquake form the landslide-dammed lake (a) Hongshiyuan landslide on left bank; (b) Chapingzi collapse on the right bank (view from upstream)

this period. For example, the emergency measure of excavating a spillway was applied on the Tangjiashan landslide dam in Beichuan County of Sichuan Province in 2008. The total volume of water contained in the dammed lake decreased to  $86 \times 10^6$  from  $2 \times 10^8$  m<sup>3</sup> after the emergency measure was taken, which notably decreased the breaching probability of the Tangjiashan landslide dam. After the first step is complete, the landslide dam can be considered to be in a safe and manageable status. Under certain conditions, the safe and manageable landslide dams have potential hydropower energy owing to huge storage capacity of their dammed lake.

The second period focuses on assessing possible economic benefits derived from transforming landslide dams into impounding dams via engineering measures. For example, a landslide occurred in Quarto Sul Savio creating a landslide dam on the Savio River in 1812. Eighteen persons died in this event from drowning upstream in the dammed lake. However, the dam was finally transformed into an impounding dam for hydropower in 1923 (Casagli and Ermini 2000). Additionally, the Waikareroan landslide dam in New Zealand which has a height of 400 m was also successfully used for hydropower; its installed capacity reached  $12.4 \times 10^4$  kW (Read and Beetham 1991).


In this research, the Hongshiyuan landslide dam induced by the Ludian earthquake is taken as a case study. The authors focus on the management strategy of this dam from soon after its formation following emergency management rules. A team of scientists from the Institute of Mountain Hazards and Environment of the Chinese Academy of Science and from Moscow

State University arrived at the area 17 days after the event. During the field campaign from 19 August to 23 August of 2014, the geomorphometric parameters of the Hongshiyuan landslide dam and its related dammed lake were measured. Soil samples from representative locations of the landslide and collapse were collected and tested in the laboratory. Based on these measured data, the stability of the Hongshiyuan landslide dam was assessed using quick quantitative and qualitative methods. This assessment led to the proposal of emergency engineering measures to prevent breaching. Given the socio-economical conditions of the area and after the safety of the Hongshiyuan landslide was deemed manageable, the economic and other benefits of using it for hydropower generation or recovering the near Hongshiyuan hydropower station were assessed.


#### Study area

The Niulanjiang River in northeastern Yunnan Province is the first tributary of the Jinsha River (Fig. 1). It acts as a demarcation line for Ludian and Huize Counties. The Hongshiyuan landslide dam (Fig. 2) is located in the river section between the Village of Hongshiyuan from the town of Huodehong in Ludian County, and the Village of Jiangbian from the town of Zhichang in Huize County ( $103^\circ 23' 56.58''$  E,  $27^\circ 2' 2.74''$  N).

The catchment area of the Niulanjiang River is 13 320 km<sup>2</sup> with a typical annual rainfall of 700–1500 mm. There is a nearby hydrologic station in the river, the Dashadian hydrologic station which is located 25 km upstream of the Hongshiyuan landslide dam. According to its hydrological data during the years 1966–1982, the

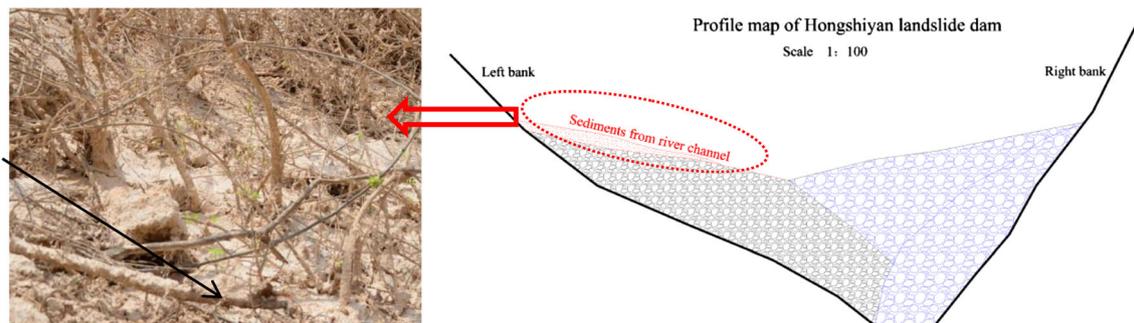

**Fig. 4** Conjectural profile map of the Hongshiyuan landslide dam based on field observations

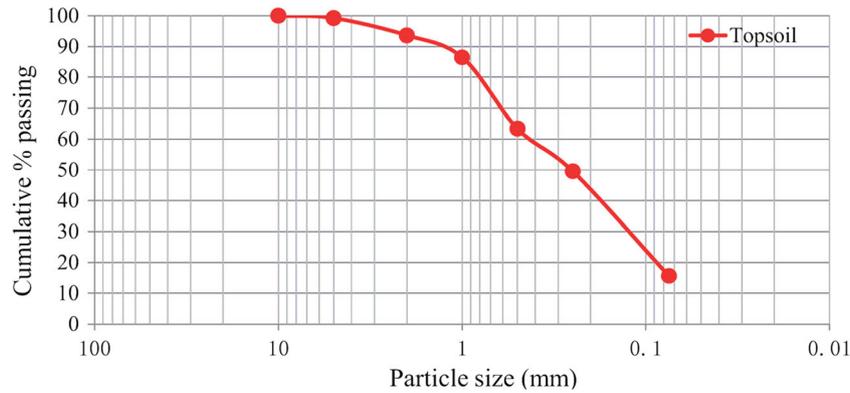

**Fig. 5** Cumulative grain size distribution of the topsoil

11,800 km<sup>2</sup> catchment area of the Hongshiyuan landslide dam had a yearly average precipitation of 912.8 mm with a maximum yearly value of 1100 mm within this river section. The average precipitation in May is 796.3 mm accounting for 87 % of the annual precipitation. The rainfall intensity in June is the highest with the maximum value of 72.5 mm in 24 h (Ma et al. 1995). Such distribution of rainfall can lead to higher peak values of floods upstream of the Hongshiyuan landslide dam. For example, the peak discharge in this river section measured by the Dashadian hydrologic station reached 1890 m<sup>3</sup>/s, which may represent a threat to the stability of the Hongshiyuan landslide dam. Landforms in the middle and lower reaches of the Niulanjiang River are characterized by high mountains and deep valleys (the average height difference between mountain ridges and valleys bottom is approximately 2000 m) making this river section suitable for hydropower generation. The theoretical potential waterpower resource in the main stream of the Niulanjiang River is approximately 1670 MW. There are eight hydropower stations in this river section, one of which (Hongshiyuan station) is located upstream of the Hongshiyuan landslide dam.

The tectonics in the region along the Niulanjiang River is characterized by compound folds in the S-N and N-E directions, which are located in the southern section of the Yaoshan tectonic belt near the Xiaojiang fault zone. It is composed of a series of large-scale and high-development faults (Fig. 2).

The stratum types in the Niulanjiang catchment are well exposed. Rocks from the Proterozoic to Quaternary are widely distributed in this region. The middle and lower reaches of the



**Fig. 6** Panoramic view of the Hongshiyuan landslide dam. This photo was taken upstream of the landslide dam

Niulanjiang River are composed of Emeishan flood basalts generated in the Permian Period. The Neocathaysian structural system distributed in eastern and central section of this catchment is a series of compressional torsion fractures and folds in the S-N direction. Influenced by the fractures and folds, two banks of the Niulanjiang River have become thickly covered by the accumulation horizon with loose structure, low shear strength, and anti-weathering ability. Consequently, landslides or collapses in this area are extremely vulnerable to triggering factors such as earthquakes or rainfall (Hu et al. 2007).

The terrain of the eastern and western regions within the Ludian section of the Niulanjiang River is higher than that of the central region. The landforms within this river section are characterized by high mountains and deep valleys caused by the strong effect of erosion and undercutting process of the Niulanjiang River. The cross-section of the river valley is mainly “V”-shaped with few river shoals.

## Methods

### Emergency field investigation

Events triggered by the Ludian earthquake

The debris deposit from the Hongshiyuan landslide and Chapingzi collapse was mainly composed of limestone (Fig. 3). However, there was a clear border in the accumulation body due to differing influence of weathering degree on the two banks (Fig. 8a). The surface of the Hongshiyuan landslide was covered by a dry layer of fine sediment with a maximum height of 109 m on the left bank (Fig. 4). The grain composition distribution of the fine sediment (shown in Fig. 5) indicated that the particles with a diameter less than 1 mm accounted for more than 85 % of the sample. This fine sediment is generated through a long separation process that might have originated in the sediment of the original Hongshiyuan reservoir.

Based on these above phenomenon and tested results, some details about the formation of this landslide and collapse can be described as follows: The Ludian earthquake first triggered the Hongshiyuan landslide on the left bank. The rockslide from the Chapingzi collapse on the right bank then ran down into the river channel with high kinetic energy. Under the action of the rock impacts, the sediment from the river channel was lifted to the left bank with a maximum height of up to 109 m above the river

**Table 1** Geomorphometric parameters of the Hongshiyuan landslide dam

Dam volume/m <sup>3</sup>	Dam height/m	Dam width/m	Dam length/m
1200×10 <sup>4</sup>	92	753	283

channel. Impacted by the lifted sediment, some plants on the accumulation body of Hongshiyuan landslide overturned in the reverse slope direction (Fig. 4).

#### The Hongshiyuan landslide dam

According to the patterns of river channel obstruction, landslide dams can be classified into six types (Costa and Schuster 1988). Type 1 landslide dams are those that do not block the valley from side to side, type 2 landslide dams block the valley entirely and may reach the opposite slope, type 3 landslide dams fill the valley and move considerably up and down the valley, type 4 landslide dams form by failure of materials from both sides of a valley, type 5 landslide dams are caused by multiple lobes of a given landslide, and type 6 landslide dams form when the failure surfaces extend under the stream bed which is raised when the landslide moves. A landslide dam could be classified as type 2, type 3, and type 5 or other types at the same time (Xu et al. 2009). The Hongshiyuan landslide dam is a type 3 and type 4 in this classification.

The debris deposit from the Hongshiyuan landslide and Chapingzi collapse blocked the river channel with a V shape and formed the Hongshiyuan landslide dam (Fig. 6).

The geomorphometric parameters of the Hongshiyuan landslide dam were measured using a laser range finder (with a precision of 0.1 m) and are shown in Table 1. In Table 1, the dam width is parallel to the Niulanjiang River flow, and the dam length is the length of the dam axis across the river.

Two samples of the debris deposit were collected from typical locations of the landslide and collapse, which were screening passed through sieves in the laboratory for analysis. The grain composition distribution of the samples from the left and right bank is shown in Fig. 7. Particles with a diameter of less than 1 mm accounted for 24.3 and 18.1 % of samples, respectively. This indicates abundant fine particles in the accumulation body of the landslide and collapse.

Due to field conditions, particles with a diameter larger than 60 mm were not sampled. However, as shown in field pictures (Fig. 8a), coarse particles accounted for a large proportion of the debris deposit. The authors visually estimated that the boulder


percentage (particle size greater than 256 mm) is supposed to be more than 50 %. Additionally, it was reported in media accounts that the main structure of Hongshiyuan landslide dam is composed by big rocks (<http://news.qq.com/a/20140808/012107.htm>). This report had further supported our visual estimation on the boulder percentage.


#### Hongshiyuan landslide-dammed lake

After the Niulanjiang River channel was blocked by Hongshiyuan landslide dam, the water level upstream rapidly increased creating the Hongshiyuan landslide-dammed lake. On August 21st, 2014, the impounded depth of the Hongshiyuan landslide-dammed lake was measured using a motorboat-mounted Lowrance 525 CF two-ray echo sounder which produces geo-referenced echograms. The device contains a GPS receiver with external antenna and a two-ray echo sounder working in the 50–200-kHz frequency band. It is capable of measuring water depths from 0.5 to 300 m with an estimated error of less than 0.2 up to 2 m of water depth and of 1 % if water is deeper. This device was successfully used for bathymetric surveys in Tian Shan, St. Elias Mts., and the Russian Caucasus (Petrakov et al. 2012). To compile the bathymetric map using calculations of lake volume and average depth, we employed ESRI ArcGIS 10.1 software. As is shown in Figs. 9 and 10, the maximum backwater distance from the landslide dam was approximately 15 km. The elevation of the dam crest was approximately 1216 m, with the water table at 1178 m. The Hongshiyuan landslide dam was 1.5 km downstream from the Hongshiyuan concrete dam. The measured volume of the water in Hongshiyuan landslide-dammed lake was  $62.5 \times 10^6 \text{ m}^3$ , and the maximum storage capacity of this landslide dam was estimated at more than  $1.2 \times 10^8 \text{ m}^3$ .

#### Rapid stability assessment

Outburst floods or debris flows frequently occur soon after the formation of a natural dammed lake; thus, a rapid assessment of landslide-dam stability is essential (Schuster and Costa 1986). The stability of Hongshiyuan landslide dam was rapidly assessed through quantitative assessment methods (Casagli and Ermini 1999, 2002; Dong et al. 2009). These methods can provide first-hand information

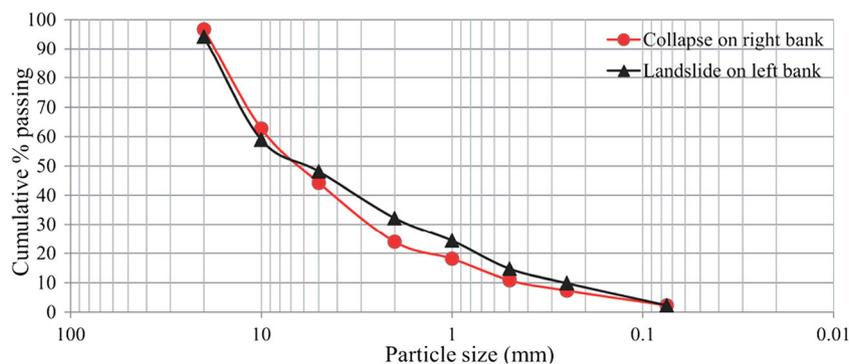**Fig. 7** Cumulative grain size distributions of the samples obtained from left and right banks

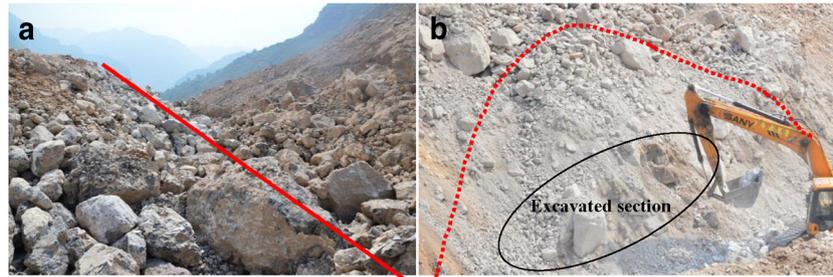

**Fig. 8** Pictures of the coarse particles in the debris deposit and the excavated section of the collapse on the right bank. **a** Photograph of the upstream direction. **b** The area within *black oval* is a typical matrix-support structure

to guide the emergency management works. The measured geomorphic variables of the Hongshiyuan landslide dam and its related dammed lake are listed in Table 2. The first-order estimation results of the rapid assessment methods are shown in Table 3.

The assessment formulae listed in Table 3 identifies catchment area  $A_b$  as the crucial factor influencing the assessment results, due to its large value (exceeding  $10,000 \times 10^6 \text{ m}^2$ ) as well as its weighting coefficient. To some degree, the catchment area can reflect the value of peak flow ( $P$ ) that discharges into the dammed lake as it correlates well with peak flow (McCuen 1998; Dong et al. 2009). Thus, a large catchment area represents a high peak flow value within the catchment. When the peak flow is larger, the risk of landslide dam breach is higher. The stability assessment of the Hongshiyuan landslide dam in Table 3 shows that the dam was in a potentially unstable state.

Qualitative stability analysis based on grain structure was also performed. Schuster (1993, 1995) pointed out that landslide dams formed by coarse particle boulders or cohesive clays are less likely to breach than dams composed of permeable soil or unconsolidated barriers. Casagli et al. (2003) analyzed the influence of grain composition on the stability of 58 landslide dams and summarized two structure types of landslide dams: matrix-supported structure (unstable type) with coarse particles scattered amongst fine particles so that there is no contact between coarse particles in the profile and grain-supported structure (stable type) composed of coarse particles in contact with each other and fine particles filling the gaps.

An excavated section of the Chapingzi collapse on the right bank is shown in Fig. 8b. As is shown in this picture, the debris deposit and grain components in this section are best characterized by the matrix-supported type. The results of laboratory tests and field observation indicate that the structure of the Hongshiyuan landslide dam was formed by both coarse and fine particles.

According to the research of Wang et al. (2010), the self-stabilization process of a landslide dam with this structure will take a long time, and the breaching risk is high during this process (Wang et al. 2010). Cui et al. (2009) proposed another rapid risk assessment method of landslide dam breaching (shown in Table 4). They classify the breaching risk into four grades including extremely high risk, high risk, medium risk, and low risk.


Based on the parameters of the Hongshiyuan landslide dam and the field observations, the breaching risk of this landslide dam is located between the levels of “high risk” and “low risk” (Table 4). Both the quantitative and qualitative rapid assessment methods indicate that the Hongshiyuan landslide dam should be considered unstable.

## Discussions

### Emergency management measures

The potentially unstable Hongshiyuan landslide dam may be susceptible to a breach at any time given some variation in the external hydrologic environment (Wassmer et al. 2004). Accordingly, emergency engineering measures should be adopted to decrease the breaching risk. The simplest and most commonly used engineering measure for stabilizing landslide dams is to build a spillway across the landslide dam (Costa and Schuster 1988). However, the proper excavation position should be carefully determined to achieve maximum effectiveness. As the water level of the dammed lake rises up to the entrance of the spillway, big rocks that have armoring potential within the spillway will stack with each other and form a stop-pool structure under the natural scouring action. This process can improve the stability of landslide dam (Wang et al. 2004).


Since the debris deposit of the Hongshiyuan landslide dam from the Chapingzi collapse is mainly composed of big rocks (Fig. 8a). If

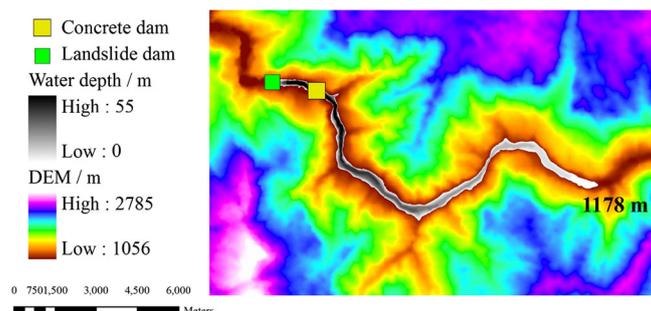

**Fig. 9** Measured depth data of Hongshiyuan landslide-dammed lake

## Cross profile

Plotting scale: horizontal 1:500, vertical 1:100

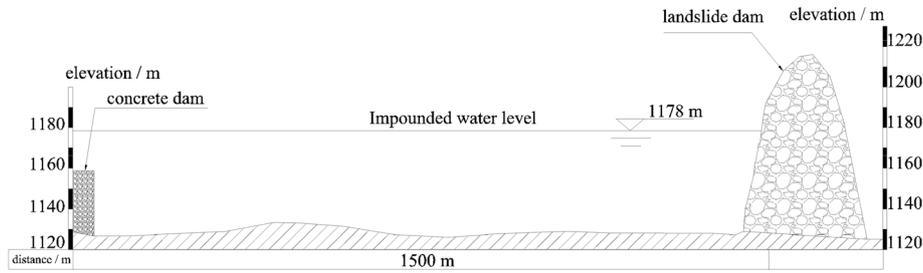

**Fig. 10** Profiles of Hongshiyuan landslide and artificial concrete dam that show the location relationship of the two dams

the excavation position is chosen on that side of the dam, it will have the potential to form a stop-pool structure. The project to excavate a spillway near the right bank started on August 10th, 2014. This spillway with a top width of 30 m, a bottom width of 5 m, and a depth of 8 m was finished on August 21st, 2014.

The spillway had a positive effect in preventing breaching induced by overtopping (Schenider et al. 2013). However, spillways excavated across landslide dams are not always successful in preventing dam failure (Costa and Schuster 1988). In order to further reduce the breaching potential of the landslide dam by overtopping, the engineering measures (e.g., the construction of spillway channels) should focus on controlling the water level of the dammed lake. The scenario in the Hongshiyuan landslide-dammed lake is unusual because there is a diversion tunnel built for Hongshiyuan hydropower station. That tunnel became flooded by the impounded water before October 4th 2014. Its upper entrance is located 1.5 km upstream from the Hongshiyuan landslide dam with the discharging end located downstream of the dam (Fig. 11). This unique situation provides a convenient opportunity to repurpose the tunnel as an emergency spillway channel. The excavation of the emergency spillway channel was advised by the authors in discussions with local authorities. This way, the water contained in the Hongshiyuan landslide-dammed lake was drained into the river channel of the Niulanjiang River.

The built emergency spillway channel was finished with a diversion capacity of 840 m<sup>3</sup>/s. It was located as suggested on the right bank of the Niulanjiang River, connecting with the diversion channel of the Hongshiyuan hydropower station ([http://society.yunnan.cn/html/2014-08/26/content\\_3341859.htm](http://society.yunnan.cn/html/2014-08/26/content_3341859.htm)). This channel with a length of 280 m was built between August 14th and October 4th, 2014. The draining of the Hongshiyuan landslide-dammed lake was completed in the evening of October 4th, 2014 (Fig. 12). This way, the water level of the impound lake and thus the safety of the Hongshiyuan landslide dam was effectively controlled.

### Integrated management

Water impounded in the Hongshiyuan landslide-dammed lake was discharged through an emergency spillway tunnel which increases the Hongshiyuan landslide dam safety. In this situation, there is sufficient time to consider a strategy for the next stage of management of Hongshiyuan landslide dam. Following international standard procedures, this landslide dam should be first considered with regard to its hydropower capacity. However, the discussion of using the Hongshiyuan landslide dam for hydropower becomes complex due to the existence of an artificial concrete dam at only 1.5 km upstream the Niulanjiang River (Fig. 10). Consequently, the ultimate decision regarding the Hongshiyuan landslide dam depends on the economic benefits of using the Hongshiyuan landslide dam over the cost of restarting the existing Hongshiyuan hydrologic power station.

### Economic analysis of Hongshiyuan landslide dam for potential hydroelectric generation

The Hongshiyuan hydropower station, 1.5 km upstream from Hongshiyuan landslide dam, was inundated by the dammed lake from August 3rd to October 3rd, 2014. It was exposed as well as the 32-m-high concrete dam after the emergency spillway tunnel was in operation (Fig. 11). The maximum installed capacity of this station was 80 MW with an expected annual energy production of 380×10<sup>3</sup> MW·h. The diversion tunnel of the Hongshiyuan hydropower station is located on the right bank of the Niulanjiang River with a diversion capacity 174 m<sup>3</sup>/s (Liu et al. 2005). The total reservoir capacity of the concrete dam is 0.693×10<sup>6</sup> m<sup>3</sup>. Public data shows a cumulative deficit exceeding 100 million CN¥ during the years of 2008–2011. The power generation in 2010 was higher than 2009; however, the deficit of 2010 was 30 % higher than in year 2009. This problem was related to design defects deriving from not taking in account the high sediment concentration of the Niulanjiang River. Abundant sediments were transported by the diversion tunnel downstream to the power house, and they were deposited near the power house increasing the elevation of the

**Table 2** Geomorphic variables of the Hongshiyuan landslide dam and its associated barrier lake

$H_d$ (m)	$W_d$ (m)	$L_d$ (m)	$V_d$ (m <sup>3</sup> )	$A_b$ (m <sup>2</sup> )	$P$ (m <sup>3</sup> /s)
92	283	753	1200×10 <sup>4</sup>	1087×10 <sup>7</sup>	1890

$H_d$  dam height,  $W_d$  dam width,  $L_d$  dam length,  $V_d$  dam volume,  $A_b$  catchment area,  $P$  peak flow

**Table 3** Stability assessment of the Hongshiyuan landslide dam using different quantitative prediction models (Casagli and Ermini 1999, 2002; Dong et al. 2009)

Prediction models	Prediction formula	Stability condition	Assessment results
Index-based graphic model	$DBI = \log(A_b * H_d * V_d^{-1})$	$DBI < 2.75$	$DBI = 4.92$ , unstable
PHWL model	$D_s = -2.94 \log(P) - 4.58 \log(H_d) + 4.17 \log(W_d) + 2.39 \log(L_d) - 2.52$	$D_s > 0$	$D_s = -4.69$ , unstable
AHWL model	$D_s = -2.62 \log(A_b) - 4.67 \log(H_d) + 4.57 \log(W_d) + 2.67 \log(L_d) + 8.26$	$D_s > 0$	$D_s = -6.7$ , unstable

riverbed downstream. The elevation of downstream riverbed above the level of the power house required continuous removal of sediments to guarantee proper operation. This increased the operational costs of power generation.

The Hongshiyuan hydropower station is a diversion-type power generation plant. Detailed data on the elevations of the intake and outlet of the diversion channel were not available for this research. Accordingly, it was not possible to exactly identify the water column height at the generator. However, this value can be estimated by the hydro-turbine output formula:

$$P = \eta 9.81 QH \quad (1)$$

where  $P$  is the hydro-turbine output,  $\eta$  is the coefficient of the hydro-turbine (90–95 %),  $Q$  is the power generation, and  $H$  is the water column at the generator. Based on the parameters of power generation at the Hongshiyuan hydrologic station ( $Q_{\max} = 174$ ,  $P_{\max} = 800,00$  kW) and Eq. 1, the water column at the power generator is in the range of 49–52 m.

The total reservoir capacity of Hongshiyuan landslide is at least  $1.2 \times 10^8$  m<sup>3</sup>, which is approximately 120 times the reservoir capacity of the Hongshiyuan hydropower station. If the Hongshiyuan landslide dam is used for impoundment, the regulation capacity for the runoff of the Niulanjiang River will be much higher than the capacity of the Hongshiyuan hydropower dam. In addition, the volume of impounded water within the Hongshiyuan landslide-dammed lake available for power generation will be much larger than the Hongshiyuan hydropower station, and this difference would be even greater during dry seasons.

The economic benefits produced by the Hongshiyuan landslide-dammed lake if used for power generation can be preliminarily estimated as follows: The corresponding capacities of the normal storage water level and the low water level are assumed to be


$50 \times 10^6$  and  $30 \times 10^6$  m<sup>3</sup>, respectively. After the impounded water reaches its normal storage level, the volume of impounded water available for power generation will be approximately  $20 \times 10^6$  m<sup>3</sup>. If the parameters of the new power generation system for the Hongshiyuan landslide dam are same as those of the Hongshiyuan hydropower station, the annual power generation of the landslide dam would be 8600 million kW·h larger. Based on Eq. 1 and the price of hydropower at 0.07 CN¥/kW·h market prices for Yunnan Province, the gross economic benefit of a new power generation system in the Hongshiyuan landslide-dammed lake is about 605 million CN¥ more than the current hydropower station each year.

It must be noted that the Hongshiyuan hydropower station is currently in a loss. In order to restart its operations it should undergo extensive repair and preparation works. This would require the removal of the Hongshiyuan landslide dam, since the maximum value of peak flow in the Niulanjiang River can reach 1890 m<sup>3</sup>/s, which is larger than the diversion capacity in place (the emergency spillway tunnel and the diversion tunnel of Hongshiyuan hydropower station, totaling 1014 m<sup>3</sup>/s). Without this measure, the water exceeding the diversion capacity of the tunnels will be blocked by the Hongshiyuan landslide dam. This newly impounded water may eventually inundate Hongshiyuan hydropower station again, which will disrupt power generation. Furthermore, the volume of the Hongshiyuan landslide is  $1200 \times 10^4$  m<sup>3</sup>, which will be extremely costly to remove.

The above analysis shows that using the Hongshiyuan landslide dam for power generation appears to yield significant economic benefits. However, been the Hongshiyuan landslide dam potentially unstable, engineering measures should be taken in order to improve the anti-leakage and strength of this dam. The cost of building a new hydro-junction revolving around the Hongshiyuan landslide dam should be concentrated on a new power generation system and a reinforcement project. As a reference, the construction project for the Hongshiyuan hydropower station took roughly

**Table 4** Risk degree classification of landslide dams (Cui et al. 2009)

Risk category	Classification indices		
	Dam height/m	Reservoir capacity/ $10^4$ m <sup>3</sup>	Material composition of dam
Extremely high risk	>100	> $10^4$	Soil texture dominated
High risk	50–100	$10^3$ – $10^4$	Soil texture with some big rocks
Medium risk	25–50	$10^2$ – $10^3$	Big rocks texture with some soil
Low risk	<25	< $10^2$	Big rocks texture dominated

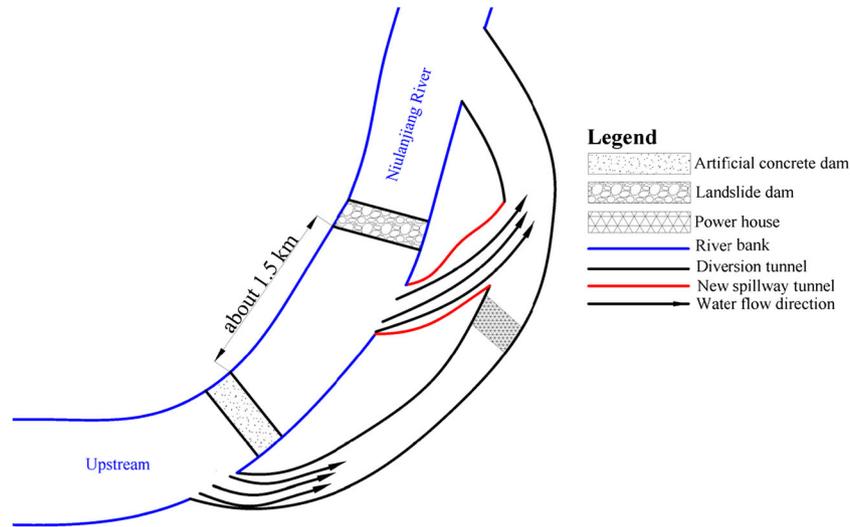

**Fig. 11** Schematic diagram of the suggested spillway tunnel. This picture also shows the location relationship of the artificial concrete dam, landslide dam, diversion tunnel, and the new spillway tunnel

2 years from December 20th, 2003, to December 31st, 2005, with a total cost of approximately 400 million CN¥.

Prices and salaries have been increased by two to three times in China during the intervening 10 years lapse from Hongshiyuan hydropower construction. If the new power generation system is similar to the Hongshiyuan hydropower station, the cost of a new hydro-junction for Hongshiyuan landslide dam could cost between 800 million and 1.2 billion CN¥. Additionally, the engineering measures to secure the dam could cost from 200 million to 300 million CN¥. Thus, the total cost of this project could range from 1 billion to 1.5 billion CN¥. The new system used for power generation should produce at least 605 million CN¥ a year. Within this prediction and considering the influence of dry years, the capital recovery period will be approximately 3 to 4 years. The investment-return ratio of transforming the Hongshiyuan landslide dam into an impounding dam is roughly 1:40 (if the service life of the stabilized dam is 100 years).



**Fig. 12** Water impounded in the dammed lake has been released by the new constructed channel. As shown in this picture taken on October 10th, the submerged artificial concrete dam has been exposed

### Suggested long-term engineering measures

According to the above analysis, transforming the Hongshiyuan landslide dam into a new hydropower junction has an excellent economic return. However, complementary engineering measures should be taken in order to permanently stabilize the Hongshiyuan landslide dam before the flood season of 2015. These measures should take into account the location of the Hongshiyuan landslide dam in an active seismic zone. The stabilization project should focus on minimizing the risk of earthquake-induced piping and landslide-triggered overtopping.

The landslide dam is formed by rapid accumulation of materials from the landslide and collapse, which is prone to leaking. Engineering measures designed to eliminate leakage are necessary for the Hongshiyuan landslide dam. The body of this landslide dam is characterized by abundant large rocks and large pores. Experiments conducted on material components, leakage characteristics, and grouting demonstrated that the structure of the dam is favorable in terms of grouting, and grouting engineering measures can deal with potential leakage issues (Zhao 2008). For example, an engineering sealant measure was applied on the Xiaonanhai landslide dam with excellent sealant effectiveness according to leakage observation in later periods (Zhao 2008). This engineering sealant measure can be applied to Hongshiyuan landslide dam, with the impervious curtain classified into different seal standards to account for differences in elevations of the Hongshiyuan landslide dam.

Another issue to be addressed is the stability of the Hongshiyuan landslide dam. In order to transform this natural dam into an impounding dam, engineering measures are necessary to strengthen its stability. The width (direction across the river) and thickness (parallel to the Niulanjiang River flow) of the downstream face of the Hongshiyuan landslide dam should be enlarged from the slope toe. Additionally, stone ballast can be used to cover the tail of the downstream face. The previous measures, complemented with some bio-stabilization (e.g., grass), should prevent slope erosion and encourage stability. Additionally, excavation and support measures should be applied on the slopes of the two banks. In

the excavation process, any geological defects (e.g., faults, fractures, and weak intercalation) should be removed, and the supporting measures should be applied in each excavation layer to protect the working face from erosion induced by rainfall. Curtain grouting can also be applied on the slopes of the two banks if necessary, which can improve the sealant performance of the slopes and prevent piping.

The Hongshiyuan landslide dam can be transformed into an impounding dam similar to an embankment dam. The suggested hydro-junction that revolves around the Hongshiyuan landslide dam can only be implemented by using the diversion mode for power generation. The emergency spillway tunnel connected to the diversion tunnel of the Hongshiyuan hydropower station can be used for flood regulation and sediment scour. A new spillway outlet for the power generation system should be built on the right bank. The design of the new power generation scheme should take full consideration of the sediment deposition issue downstream of the powerhouse.

### Conclusions

The Hongshiyuan landslide dam was identified immediately after its formation as potentially unstable via quantitative and qualitative methods based on field measurements. According to an emergency management strategy, urgent measures such as the excavation of a spill way across the dam and an emergency spillway tunnel were timely deployed in order to reduce breaching risks. Two options for post-emergency management of the Hongshiyuan landslide dam where contrasted: power generation or removing the accumulation body. Some conclusions are drawn as follows:

1. The emergency field investigation and rapid stability assessment indicated that the Hongshiyuan landslide dam was unstable. But the economic benefit of using this dam for power generation is significant. This is due to the storage capacity of the Hongshiyuan landslide-dammed lake which is 170 times the capacity the Hongshiyuan hydropower station. Furthermore, the investment-return ratio of the engineering measures needed to transform the Hongshiyuan landslide dam into an impounding dam is roughly 1:40, which indicates excellent economic return.
2. Due to the larger capacity of the landslide dam reservoir, the regulation capacity of the runoff in the Niulanjiang River will increase, which will make this landslide dam and its related lake a hydroelectric project with seasonal regulation capacity. The Niulanjiang catchment is characterized as a typical dry-hot valley with a clear boundary between wet and dry seasons. Depending on its regulation capacity, the suggested hydro-junction should effectively control the peak flow during the flood seasons, which can protect the large-scale hydropower stations (Xiangjiaba and Xiluodu hydro-junction), located downstream on the Jiansha River. During the dry seasons, this hydro-junction can provide the water to the counties of Qiaojia, Ludian, and Zhaoyang (also depending on its seasonal regulation capacity). Besides these functions, the reinforced Hongshiyuan landslide dam and dammed lake can also be used for developing the local tourist industry.
3. Landslide dams being used for power generation are uncommon. The preliminary scheme processing of the Hongshiyuan

landslide dam can provide a reference framework to explore long-term landslide dam management.

### Acknowledgements

This research is supported by the Cooperation Project between Governments of China and Russia (Grant No. CR17-2) and RFBR (Grant No. 14-05-00768).

### References

- Canut P, Casagli N, Ermini L (1998) Inventory of landslide dams in the Northern Apennine as a model for induced flood hazard forecasting. In: Andah K (ed) Managing hydro-geological disasters in a vulnerable environment. CNR-GNDCI Publication 1900. CNR-GNDCI-UNESCO (IHP), Perugia, pp 189–202
- Casagli N, Ermini L (1999) Geomorphic analysis of landslide dams in the Northern Apennine. *Trans Jpn Geomorphological Union* 20(3):219–249
- Casagli N, Ermini L (2000) Landslide dam management: from hazard source to environmental resource. In: Andah K (ed) Water resources management in a vulnerable environment for sustainable development. CNR-GNDCI Publication 2115 CNR-GNDCI-UNESCO (IHP), Perugia, pp 209–219
- Casagli N, Ermini L (2002) Prediction of the behavior of landslide dams using a geomorphological dimensionless index. *Earth Surf Process Landf* 28:31–47
- Casagli N, Ermini L, Rosati G (2003) Determining grain size distribution of the material composing landslide dams in the Northern Apennines: sampling and processing methods. *Eng Geol* 69:83–97
- Chen KT, Kuo YS, Shieh CL (2014) Rapid geometry analysis for earthquake-induced and rainfall-induced landslide dams in Taiwan. *J Mt Sci* 11(2):360–370
- Costa JE, Schuster RL (1988) The formation and failure of natural dams. *Geol Soc Am Bull* 100:1054–1068
- Costa JE, Schuster RL (1991) Documented historical landslide dams from around the world. US Geological Survey Open-File Report 91–239, 1–486. <http://pubs.usgs.gov/of/1991/0239/report.pdf>
- Cui P, Han YS, Chen XQ (2009) Distribution and risk analysis of dammed lakes reduced by Wenchuan earthquake. *Journal of Sichuan University (Engineering Science Edition)* 41(3):35–42 (in Chinese)
- Dai FC, Lee CF, Deng JH, Tham LG (2005) The 1786 earthquake-triggered landslide dam and subsequent dam-break flood on the Dadu River, southwestern China. *Geomorphology* 65:205–221
- Dal Sasso SF, Sole A, Pascale S, Sdao F, Bateman PA, Medina V (2014) Assessment methodology for the prediction of landslide dam hazard. *Natural Hazards and Earth System Science* 14:557–567
- Dong JJ, Tung YH, Chen CC, Liao JJ, Pan YW (2009) Discriminant analysis of the geomorphic characteristics and stability of landslide dams. *Geomorphology* 110:162–171
- Dong JJ, Tung YH, Chen CC, Liao JJ, Pan YW (2011) Logistic regression model for predicting the failure probability of a landslide dam. *Eng Geol* 117:52–61
- Dong JJ, Lai PJ, Chang CP, Yang SH, Yeh KC, Liao JJ, Pan YW (2014) Deriving landslide dam geometry from remote sensing images for the rapid assessment of critical parameters related to dam-breach hazards. *Landslides* 11:93–105
- Ermini L, Casagli N, Farina P (2006) Landslide dams: analysis of case histories and new perspectives from the application of remote sensing monitoring techniques to hazard and risk assessment. *Ital J Eng Geol Environ special issues* 1:45–52
- Hu J, Tang LM, Tang C (2007) Study on characteristics and formation factor of geological hazards in Ludian County of Yunnan province. *Journal of Geological Hazards and Environment Preservation* 18(4):15–19 (in Chinese)
- King J, Loveday I, Schuster RL (1989) The 1985 Bairaman landslide dam and resulting debris flow. *Q J Eng Geol* 22(4):257–270
- Korup O (2002) Recent research on landslide dams—a literature review with special attention to New Zealand. *Prog Phys Geogr* 26:206–235
- Korup O (2004) Geomorphic hazard assessment of landslide dams in South Westland, New Zealand: Fundamental problems and approaches. *Geomorphology* 66:167–188
- Liu GG, Liu GH, Chen B (2005) Test study on the movable-bed model for Hongshiyuan hydropower station. *Water Power* 31(6):27–28 (in Chinese)
- Ma XL, Zhu ML, Fan RH (1995) County annals of Ludian. Yunnan People's Publishing House, Kunming (in Chinese)

- McCuen RH (1998) Hydrologic analysis and design, Prentice Hall, Englewood Cliffs
- Mora S, Madrigal C, Estrada J, Schuster RL (1993) The 1992 landslide dam, Costa Rica. *Landslide News* 7:19–22
- Peng M, Zhang LM (2013) Breaching parameters of landslide dams. *Landslides* 9:13–31
- Petley D (2010) Hunza landslide monitoring. <http://hunzalandslide.blogspot.com>
- Petrakov DA, Tutubalina OV, Aleinikov AA, Chernomorets SS, Evans SG, Kidyayeva VM, Krylenko IN, Norin SV, Shakhmina MS, Seynova IB (2012) Monitoring of Bashkara glacier lakes (Central Caucasus, Russia) and modelling of their potential outburst. *Nat Hazards* 61(3):1293–1316
- Plaza NG, Yepes H, Schuster RL (1990) Landslide dam on the Pasque River, Northern Ecuador. *Landslide News* 4:2–4
- Read SA, Beetham R (1991) Lake Waikaremoana barrier a large landslide dam in New Zealand. *Landslide News* 51(4):1481–1487
- Schenider JF, Gruber FE, Mergili M (2013) Impact of large landslides, mitigation measures. *Ital J Eng Geol Environ* 6:73–84
- Schuster RL (1993) Landslide dams—a worldwide phenomenon. In: Proceedings annual symposium of the Japanese Landslide Society, Kansai Branch, 27 April, Osaka: 1–23
- Schuster RL (1995) Landslide dams—a worldwide phenomenon. *Journal Japanese Landslide Society* 31(4):38–49
- Schuster RL, Costa JE (1986) A perspective on landslide dams: In Schuster, R.L., ed., *Landslide dams—processes, risk, and mitigation: Geotechnical Special Publication No. 3*, American Society of Civil Engineers: 1–20. <http://cedb.asce.org/cgi/WWWdisplay.cgi?48090>
- Shang YJ, Yang ZF, Li LH, Liu DA, Liao QL, Wang YC (2003) A super-large landslide in Tibet in 2000: background, occurrence, disaster, and origin. *Geomorphology* 54:225–243
- Swanson FJ, Oyagi N, Tominaga M (1986) Landslide dam in Japan. In: Schuster RL (ed) *Landslide Dam: Processes Risk and Mitigation*, American Society of Civil Engineers, Geotechnical Special Publication 3:131–145
- Wang ZY, Xu J, Li CZ (2004) Development of step-pool sequence and its effects in resistance and stream bed stability. *Int J Sediment Res* 19(3):161–171
- Wang ZY, Cui P, Liu HX (2010) Management of quake lakes and triggered mass movements in Wenchuan earthquake. *ShuiliXuebao* 41(7):757–763 (in Chinese)
- Wassmer P, Schneider JL, Pollet N, Schmitter-Voirin C (2004) Effects of internal structure of a rock-avalanche dam on the drainage mechanism of its impoundment, Films Sturzstrom and Illanz paleo-lake, Swiss Apls. *Geomorphology* 61:3–17
- Xu Q, Fan XM, Huang RQ, Westen CV (2009) Landslide dams triggered by the Wenchuan Earthquake, Sichuan Province, south west China. *B Eng Geol Environ* 68:373–386
- Zhao YH (2008) Seepage control of the earthquake-induced barrier bar of Xiaonanhai Reservoir. *Advances in Science and Technology of Water Resources* 28(5):39–44 (in Chinese)

---

#### S. Zhang

Key Laboratory of Mountain Hazards and Earth Surface Process, Chinese Academy of Sciences, Chengdu, 610041, China

#### S. Zhang · X. Xie · F. Wei (✉) · R. D. Tellez

Institute of Mountain Hazards and Environment, Chinese Academy of Sciences, Chengdu, 610041, China  
e-mail: fqwei@imde.ac.cn

#### S. Chernomorets · D. Petrakov

Faculty of Geography, Moscow State University, Moscow, Russia

#### I. Pavlova

Institute of Geography, Russian Academy of Sciences, Moscow, Russia

#### F. Wei

Chongqing Institute of Green and Intelligent Technology, Chinese Academy of Science, Chongqing, 400714, China

#### R. D. Tellez

Nipe Sagua Baracoa Mountain Office, Ministry of Science, Technology and Environment of Cuba, Guantanamo, Cuba